#### **UNCLASSIFIED**

# AD NUMBER AD499520 CLASSIFICATION CHANGES TO: UNCLASSIFIED FROM: CONFIDENTIAL LIMITATION CHANGES

#### TO:

Approved for public release; distribution is unlimited.

#### FROM:

Distribution authorized to U.S. Gov't. agencies and their contractors;

Administrative/Operational Use; DEC 1952. Other requests shall be referred to Naval Proving Ground, Dahlgren, VA.

#### **AUTHORITY**


NSWC ltr 29 Jan 1976 ; NSWC ltr 29 Jan 1976


THIS REPORT HAS BEEN DELIMITED AND CLEARED FOR PUBLIC RELEASE UNDER DOD DIRECTIVE 5200.20 AND NO RESTRICTIONS ARE IMPOSED UPON ITS USE AND DISCLOSURE.

DISTRIBUTION STATEMENT A

APPROVED FOR PUBLIC RELEASE;
DISTRIBUTION UNLIMITED.

## Best Available Copy





AD499520

U. S NAVAL PROVING GROUND DAHLGREN, VIRGINIA

REPORT NO 1064

5"/54 PROJECTILES TYPE EX 23 MOD 1; TEST OF

15th Partial Report

RECOVERY FIRING OF 5"/54 PROJECTILES
TYPE EX 23 MOD I IN A WORN GUN

FINAL Report

Assignment NPG-Re3b-207-2-52

Copy No. 2

LIBRARY OF CONGESTION REFERENCE DEPARTMENT


TECHNICAL IN UNMATION DIVISION

FORMERLY


(NAVY RESEARCH SECTION)

DEC 161952

Morrogility







NPG REPORT NO. 1064

Recovery Firing of 5"/54 Projectiles
Type EX 23 Mod 1 in a Worn Gun

#### PART A

#### SYNOPSIS

- 1. Three (3) 5"/54 projectiles Type EX 23 Mod 1 were fired for spin and recovery from a 5"/54 Mk 18 gun in the last quarter of its life, at a charge that gave 28 tsi (copper) proof pressure in a new barrel. This test was fired to determine the performance of the projectiles in a worn gun.
- 2. It is concluded that the performance of the projectile Type EX 23 Mod 1 when fired in a worn gun (1358 ESR), at approximately 3050 ft./sec. velocity, is unsatisfactory because of excessive body engraving, yaw and erratic flight as noted by yaw cards.





#### Recovery Firing of 5"/54 Projectiles Type EX 23 Mod 1 in a Worn Gun

#### TABLE OF CONTENTS

																														P	age	
s:	YNC	PS	ΒI	S	•	•	٠		•	•	•	•	•	•	•	•	•	•	•	•	٠	•	•	•	•	•	•	•	•		1	
T A	ABI	E	0	F	CC	Ŋ	ΤE	N	TS	•	•	•		•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•		2	
ΑŪ	J <b>T</b> F	łOF	RI	ΤY	•	•	•		•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•		3	
RI	EFE	ERE	EΝ	CE	S	•	•			•	•	•	•	•	•		•		•	•	•	•	•	•		•	•	•	•		3	
В	ACF	GF	20	UN	D	•	•		•	•	•	•	•	•	•	•	•		•	•	•	•	•	•	•	•	•	•	•		3	
OB	BJE	ci	י י	OF	1	E	ST		•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•		3	
PF	ER 1	10	)	OF	T	Έ	ST		•	•	•	•	•	• ;	•	•	•	•	•	•	•	•	•	•	•	•	•	•	٠		3	
DI	ESC	RI	P'	ΓI	10	Į	OF		ΙT	EM	S	UN	DE	ER	TI	EST		•	•		•	•	•	•	•	•	•	•	•		4	
PF	<b>RO</b> (	EI	U	RE	•	•	•		•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•		4	
RI	ESU	JLI	S	A	NI	)	DI	S	cu	SS	IC	N	•	•	•	•	•	•	•	•	•	•	•	•	٠	•	•	•	•		4	
cc	ONC	LU	JS	10	N	•	•		•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•		5	
ΑI	PPE	ENE	ΟI	X	A		N	P	G	PH	01	oG	RA	\PI	łS	AN	ID	SF	EI	CH	I <b>.</b>	•	•	•	F	[Gl	JRE	ES	1-5	5	(Inc	l)
ΑI	PPE	ENI	ΟI	X	3	-				_		RE	-		-			-			•	•	•	•	•	•			1	L	(Only	y )
A E	ם ס כ	'NI I	) <b>T</b>	Y	C	_	ח	T	ሮ ጥ	рT	זמ	ነ <b>ጥ</b> ፓ	O.	ı															1		(On 1 s	(r \





CONFIDENTIAL

NPG REPORT NO. 1064

Recovery Firing of 5"/54 Projectiles Type EX 23 Mod 1 in a Worn Gun

#### PART B

#### INTRODUCTION

#### AUTHORITY:

This test was authorized by reference (a).

#### 2. REFERENCES:

- BUORD 1tr Re3b-PB:mt S78-1(5") Ser 14521 of 16 Feb 1952 to NAVPROV

- b. NPG Report No. 984 of 18 Aug 1952
  c. NPG Report No. 505 of 2 Mar 1950
  d. NPG Report No. 437 of 1 Dec 1949
  e. BUORD SK. No. 238969 5"/54 Projectile Type EX 23 Mod 1

#### 3. BACKGROUND:

The Bureau of Ordnance requested a recovery firing program as outlined in reference (a) to determine the performance of the projectile band in a worn barrel. Previous firings of the subject projectiles for recovery from new barrels (references (b), (c), and (d)) have been reported.

#### 4. OBJECT OF TEST:

The object of this test was to determine the pressure, velocity, spin, and condition upon recovery of projectiles Type EX 23 Mod 1 fired from a worn 501/54 caliber gun.

#### 5. PERIOD OF TEST:

- a. Date of Directive
- b. Date Commenced Test
  c. Date Test Completed
- 16 February 1952
  - 4 May 1952
- 6 May 1952

Recovery Firing of 5"/54 Projectiles
Type EX 23 Mod 1 in a Worn Gun

#### PART C

#### DETAILS OF TEST

#### 6. DESCRIPTION OF ITEMS UNDER TEST:

- a. Projectiles: 5"/54 projectiles Type EX 23 Mod 1 in accordance with reference (e) (See Figure 1).
- b. Gun: 5"/54 gun Mk 18 Mod 1, Serial No. 16064. This gun has a 1 in 25 caliber twist, a standard service velocity of 2650 ft./sec., and had an origin enlargement before firing (1358 ESR) of 0"290.

#### 7. PROCEDURE:

Three (3) 5"/54 projectiles Type EX 23 Mod 1 were prepared for recovery firing by fitting with flat dummy nose plugs (Figure 5) and Epsom salt loading to a total weight of 60 lbs.

Spin was measured by the wire impression method, described in Appendix (B). Pictures were taken of the recovered projectiles. The projectiles were fired with a charge equivalent to that which gave approximately 28 tsi and 3290 ft./sec. in a new gun previously tested (reference (b)).

#### 8. RESULTS AND DISCUSSION:

The firing data are as follows:

Rd.	Proj.	Powder Charge EX 6882 (1bs.)	Breech Pressure (t.s.i.)	Muzzle Veloctiy (ft./sec.)	%. Nominal Spin	Max. Dia. Hole in Yaw Card (in.)
1	1293	23.0	19.6	3047	98.1	5-1/2
2	1294	23.0	20.5	3070	9 <b>8.</b> 2	5-1/2
3	1295	23.0	18.7	3053	99.1	6-1/2

The after-firing pictures are included as Figures 2-4, inclusive.

CONFIDENTIAL SECURITY INFORMATION



#### Recovery Firing of 5"/54 Projectiles Type EX 23 Mod 1 in a Worn Gun

Body engraving and partial failure of the bands occurred on rounds 2 and 3. Round 1 (warming round) did not body engrave.

The velocity and spin were uniform, but the attainment of full spin can probably be attributed to the fact that the projectiles body-engraved. The pressure variations shown are considered normal for this type of powder under these conditions.

The yaw card at the recovery bin showed yaw and a rather large dispersion pattern at 447 feet from the gun.

#### PART D

#### CONCLUSION

#### 9. It is concluded that:

The performance of the projectile Type EX 23 Mod 1 when fired in a worn gun (1358 ESR), at approximately 3050 ft./sec. velocity, is unsatisfactory because of excessive body engraving, yaw and erratic flight as noted by yaw cards.







NPG REPORT NO. 1064

Recovery Firing of 5"/54 irojeviles Type EX 23 Mod 1 in a Worn han

The tests upon which this report is based were conducted by:

R. D. CROMWELL, Plate Fuze Battery Officer

Terminal Ballistics Department

R. B. BUTLER, Head, Design Branch Terminal Ballistics Department

This report was prepared by:

R. B. BUTLER, Head, Design Branch Terminal Ballistics Department

This report was reviewed by:

H. DeROCHER, Head, Engineering Division

Terminal Ballistics Department

R. H. LYDDANE, Director of Research

Terminal Ballistics Department

E. L. LEVSTIK, Lieutenant Commander, USNR

Terminal Ballistics Batteries Officer

Terminal Ballistics Department

W. B. ROBERTSON, Lieutenant Commander, USN

Terminal Ballistics Officer

Terminal Ballistics Department

C. C. BRAMBLE, Director of Research, Ordnance Group

APPROVED:

J. F. BYRNE Captain, USN

Commander, Naval Proving Ground

Tuchune-

E. A. RUCKNER

Captain, USN Ordnance Officer

By direction



1

1

NPG REPORT NO. 1064

U. S. NAVAL PROVING GROUND DAHLGREN, VIRGINIA

Fifteenth Partial Report

on

5"/54 Projectiles Type EX 23 Mod 1; Test of

Final Report

on

Recovery Firing of 5"'54 Projectiles Type EX 23 Mod 1 in a Worn Gun

Project No.: NPG-Re3b-207-2-52 Date:

Copy No.: 2

No. of Pages: 6






NP9-49159


6 May 1952

Photograph of 5"/54 Projectile Type EX 23 Mod 1 Before Firing Figure 1

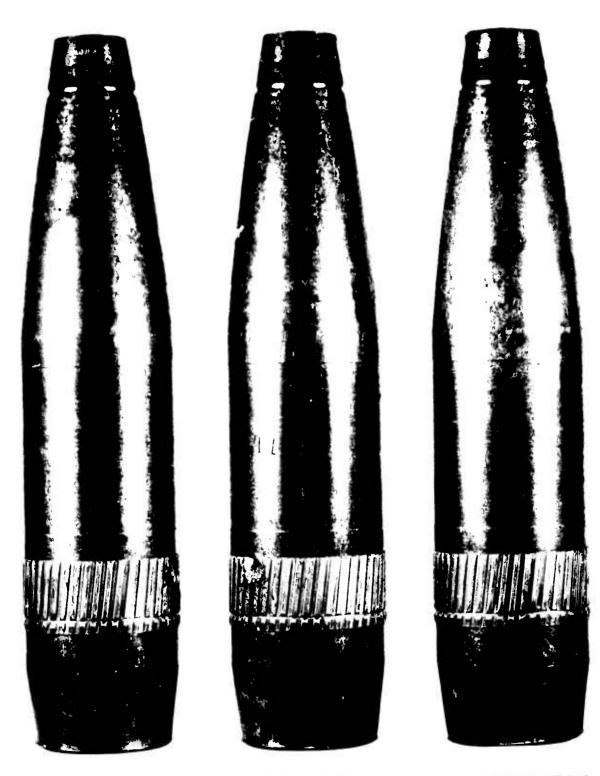


NP9-49160

o May 1952 CONFIDENTIAL SECURITY INFORMATION
Three views (120° apart) of Recovered EX 23-1 Projectile
No. 1293, Fired in Gun Mk 18 Mod 1 No. 16064.
Figure 2

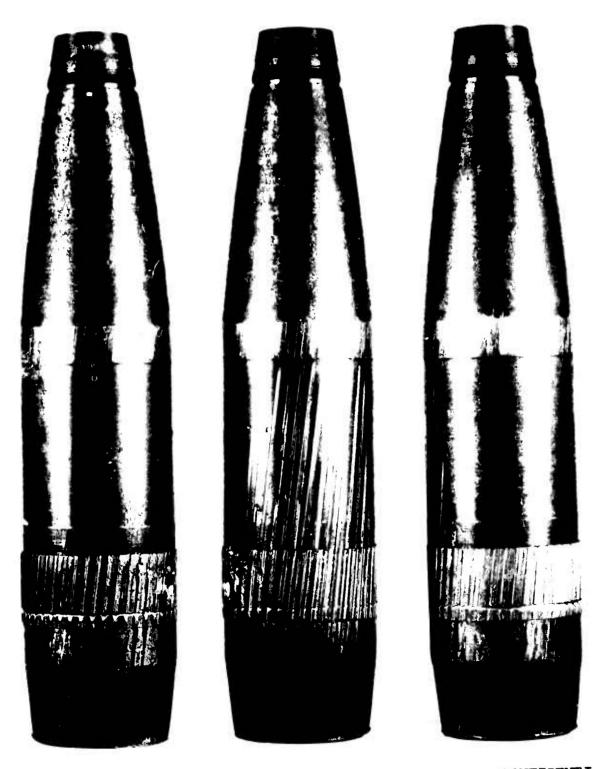


NP9-49161

o May 1952 CONFIDENTIAI
SECURITY INFORMATION
Three Views (120° apart) of Recovered EX 23-1 Projectile
No. 1294, Fired in Gun Mk 18 Mod 1 No. 16064.
Figure 3

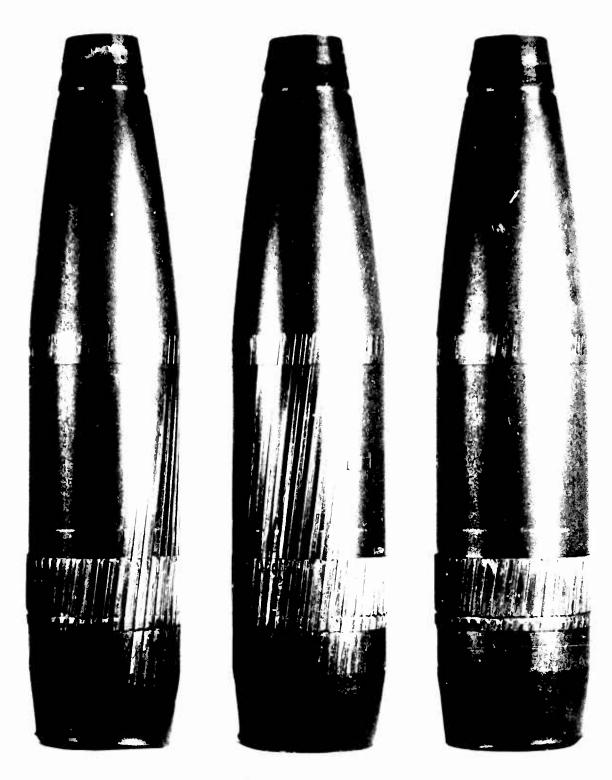

NP9-50921


CONFIDENTIAL
SECURITY INFORMATION
Three views (120° apart) of Recovered EX 23-1 Projectile
No. 1295, Fired in Gun Mk 18 Mod 1 No. 16064.
Figure 4

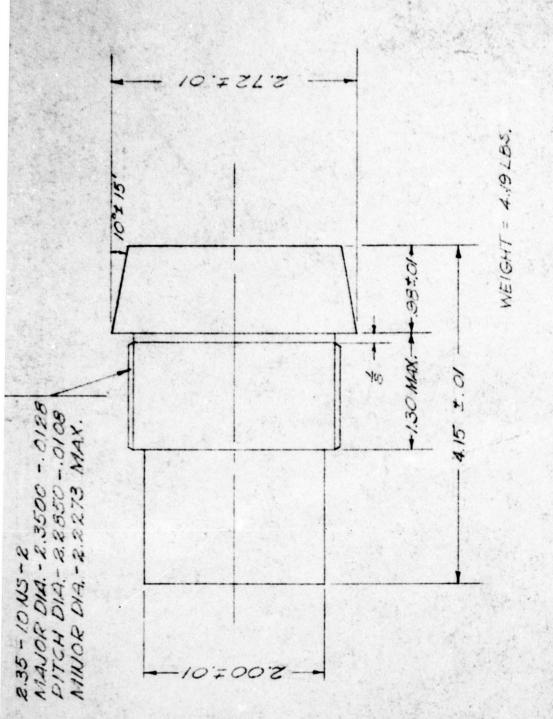

MODIFIED MOSE PLUG FOR KECOVERY FIRMS.

12 AUGUST 1949 APL - 262

with





Recovery Firing of 5th/54 Projectiles
Type EX 23 Mod 1 in a Worn Gun

#### Wire Impression Method of Determining Spin

Two screens are set up 4175 apart, each screen consisting of a metal frame with wood inserts, holding an array of parallel equidistant vertical copper wires. The spacing of the wires is 1/2" for the first screen and 3/4" for the second. The projectile is fitted with a flat-nosed dummy nose plug or the equivalent, so that after passing through the screens it bears two sets of impressions of the wires. The angle between the two sets of impressions is measured and from this measurement the rifling of the gun, the muzzle velocity, and the velocity at the spin screens, is computed the percentage of nominal spin. It is assumed that over the short distances involved the spin retardation is negligible.





NPG REPORT NO. 1064

### Recovery Firing of 5"/54 Projectiles Type EX 23 Mod 1 in a Worn Gun

#### DISTRIBUTION

#### Bureau of Ordnance:

Ad3 Re5 Re5a Re3 Re3b	1 1 1 1 1
Chief of Ordnance Department of the Army Attn: ORDTX-AR	2
Commanding General Aberdeen Proving Ground Aberdeen, Maryland Attn: Technical Information Section Development and Proof Services	1
Commanding Officer Frankford Arsenal Philadelphia, Pennsylvania	1
Navy Research Section Library of Congress Washington 25, D. C. (Via BUORD Re5)	2
Local:	
OTE-1 OTL OT File	1 1 1

